


SEQUENCE 1.20



MANUAL ADDENDUM




We've encountered a few instances in which the blind nuts in the canopy hatch do not align with the holes in the fuselage making it difficult to install the canopy hatch screws. The quick, easy fix is to relocate the blind nuts as illustrated:

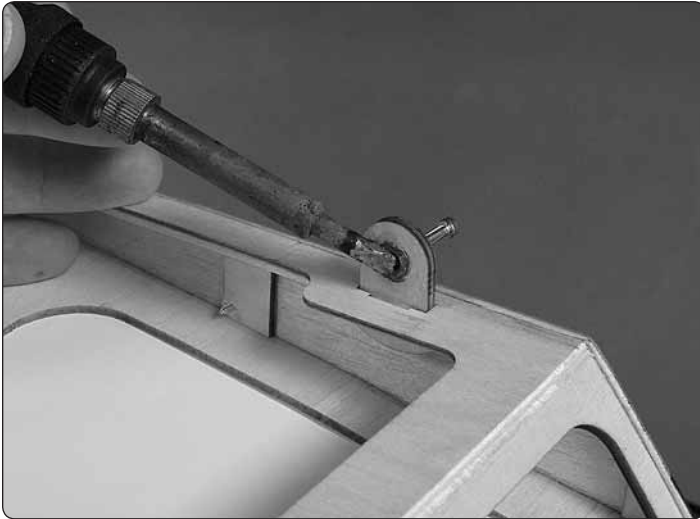

1. Insert a 4-40 bolt a couple turns into the blind nut. Use a soldering iron to heat the blind nut to melt the glue, then you can easily push the blind nut out.

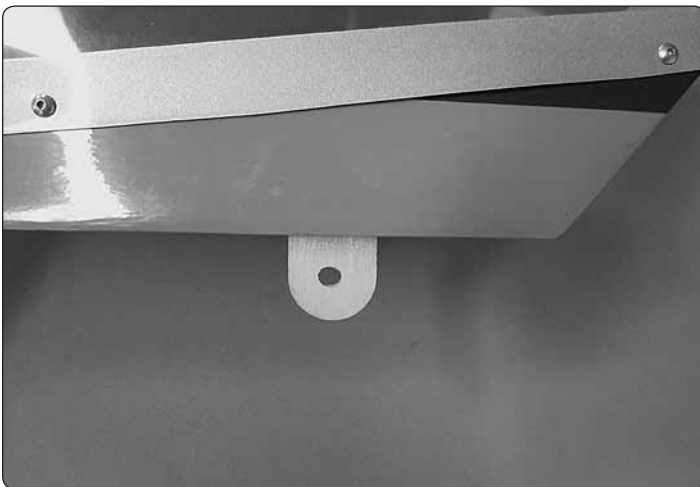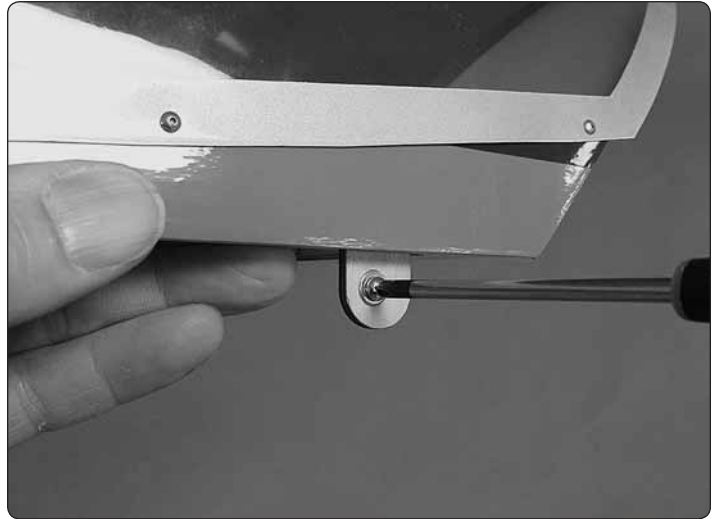

2. Cut any residual glue off the back of the tab and use a hobby knife or a rotary tool to elongate the hole as necessary.

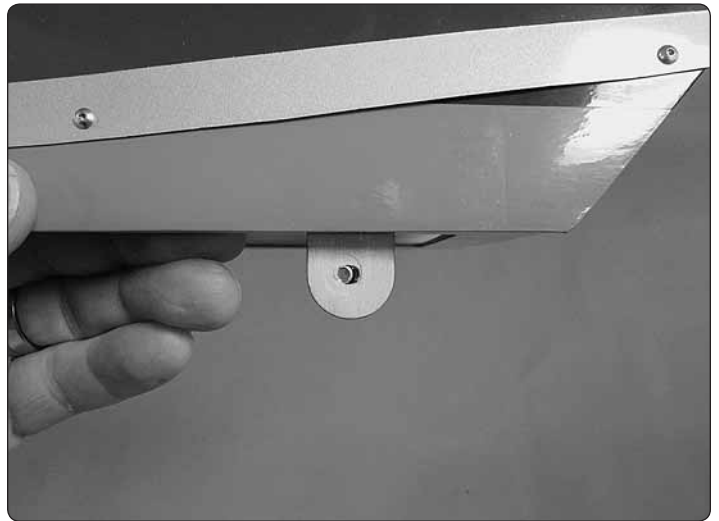

3. Reinstall the blind nut and draw it all the way back in with a 4-40 bolt and a washer. Add a few drops of CA around the flange on the back of the blind nut to hold it into position.

4. Adjust other blind nuts as necessary.

