



EP YAK 55 3D

TECH NOTICE


The 90° bends on the control surface pushrods may be improperly bent, preventing connection to the control surfaces. To correct the bends please follow the steps below.

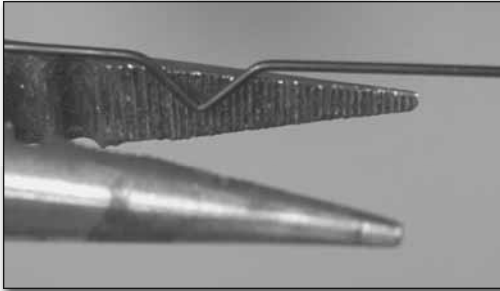

1. Secure the pushrod at the V bend with pliers.

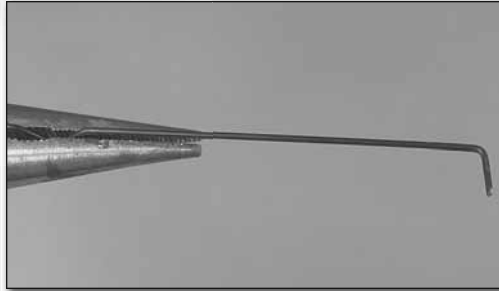

2. Grip the 90° bend with an additional set of pliers.

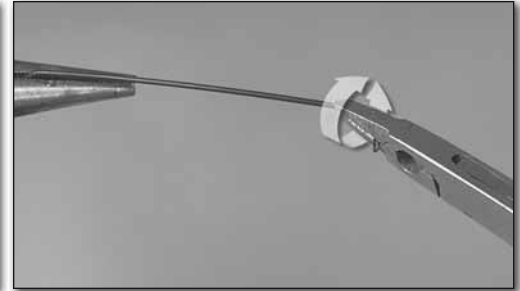

3. Twist the pliers holding the 90° bend in the proper direction to secure the pushrod to the control surface.

If your pushrods are damaged during this process, please contact product support for replacements.

Great Planes Product Support
3002 N. Apollo Drive, Suite #1
Champaign IL 61822
productsupport@greatplanes.com

Telephone: (217) 398-8970. M-F, 8am-5pm Central
FAX: (217) 398-7721 Please be sure to include a daytime
telephone or return fax number so that we can contact you.

