


Top Flite Giant P-51D Mustang ARF Technical Notice

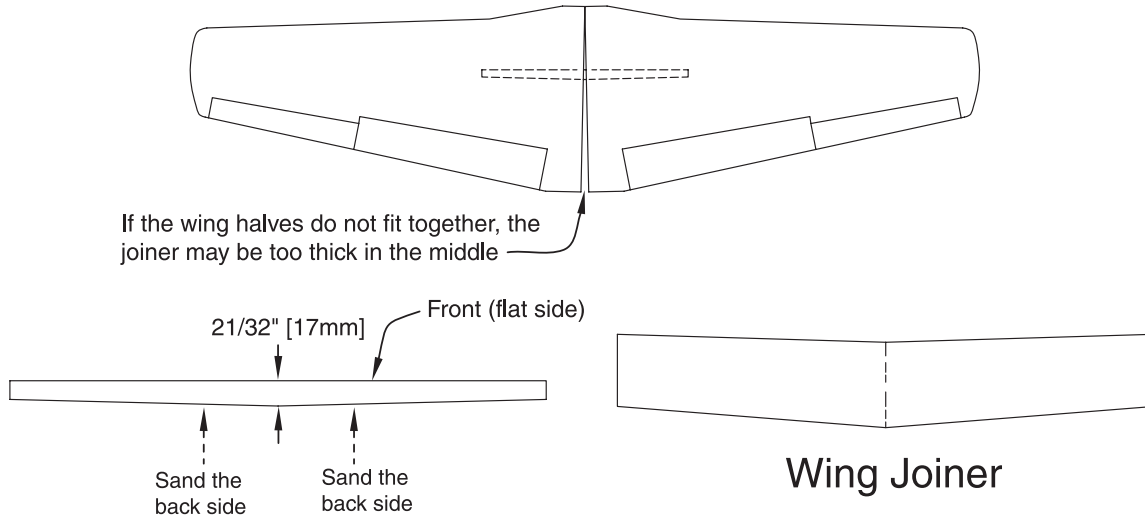

The **wing joiner** in a few kits may be too thick in the middle which could prevent the wings from fitting together all the way. The thickest part of the joiner should be 21/32" [17mm] in the middle. If, after test-fitting your wings together with the joiner, the wings will not completely come together, use a fine-point ballpoint pen to mark a centerline on the back of the joiner. Using the centerline as a guide, sand the **back side** of the joiner with coarse sandpaper until it is the correct thickness and you can get the wings to fit. **Note:** The instruction manual refers to plywood on the joiner, but current wing joiners are one-piece hardwood with no plywood lamination. The front of the joiner is the side that is flat.